
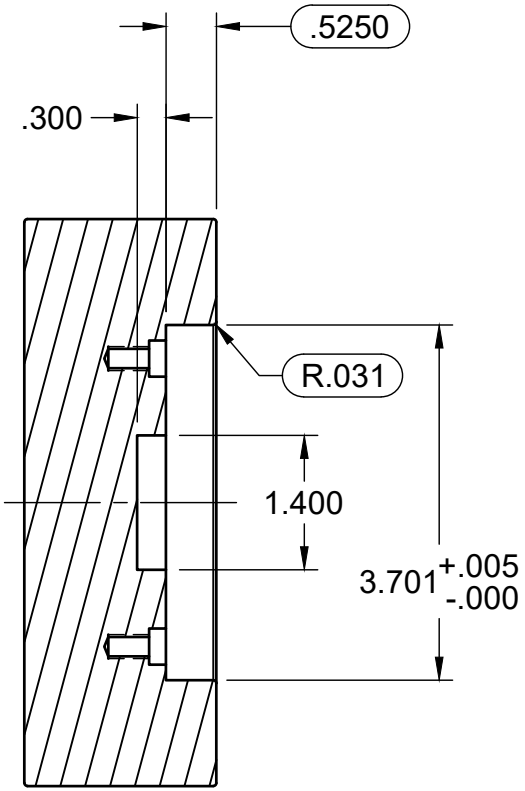


SECTION A-A

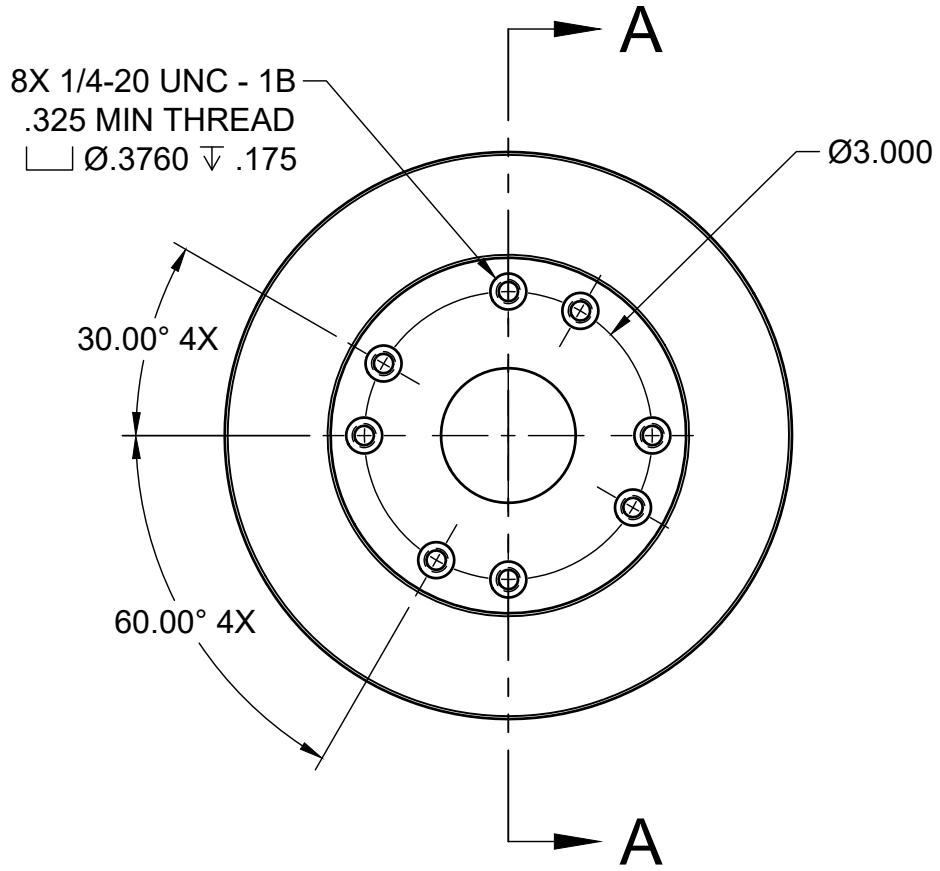

NOTES

1. CIRCLED DIMENSIONS ARE CRITICAL. DO NOT OMIT OR ALTER THESE FEATURES.
2. BREAK SHARP EDGES 0.005 - 0.015
3. ALL FEATURES ON A COMMON CENTERLINE CONCENTRIC WITHIN 0.005
4. THREAD FORMING TAP RECOMMENDED ON TAPPED HOLES
5. INTERNAL CORNERS 0.000 - 0.015 FILLET OK
6. MAXIMUM RECOMMENDED PALLET DIMENSIONS ARE Ø8.000 X 6.000

DIMENSIONS ARE IN INCHES UNLESS NOTED .X = ± 0.1 .XX = ± 0.01 .XXX = ± 0.005 .XXXX = ± 0.001	PIERSON WORKHOLDING
MATERIAL 6061-T6 Alum	MAX-4 Pallet Gen2 Dimensions